


X-Ray of M2

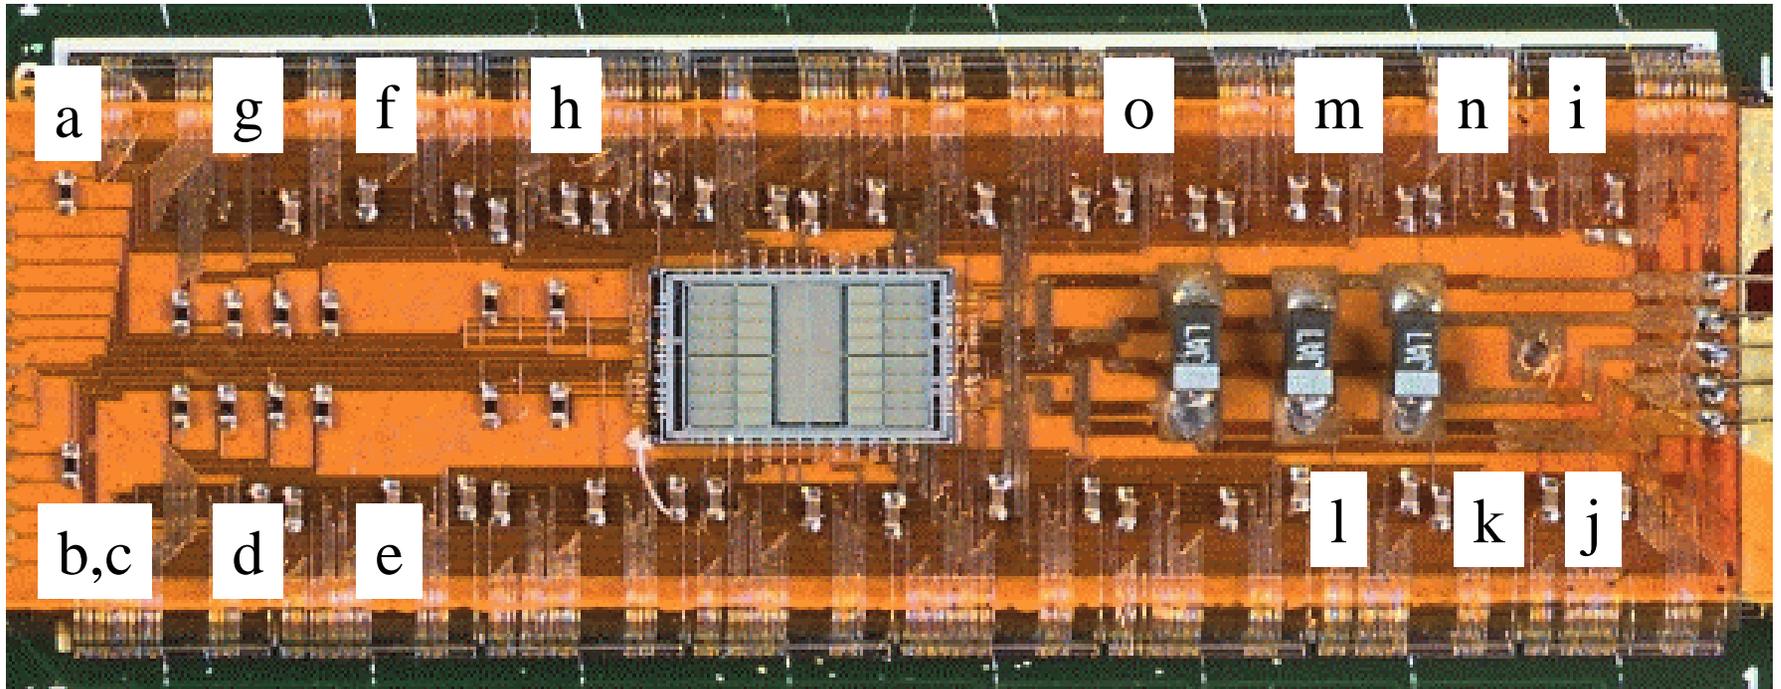

- ICs disconnected - last four on both ends. All chips operated OK initial. Later failure.
- Supposition is CTE mismatch from gluing to Al support plate, followed by creep from sufficient shear forces to finally cause joints to break near ends.
- Photos clearly show greater displacement near ends.

